

Recall Notice

September 23, 2010
Post until: January 23, 2011



Product Recall Program Siemens and Murray circuit breakers Single and double pole, 15 through 50 Amps

The products at issue are Siemens and Murray one inch plug-in circuit breakers, single and double pole, 15 through 50 amps, covering the 13 breaker catalog numbers and 10 enclosures (load center and meter combos) which contain these breakers.

These Siemens and Murray circuit breakers, with date codes 0610 and 0710, may have a non-conforming "spring clip" plug-in assembly that breaks or fails to provide sufficient force to maintain a proper electrical connection in the panelboard. Over time, this condition could lead to excessive temperature, arcing or thermal

damage at the connection point, and potential damage to the panelboard's electrical insulation. Such activity may, in extreme situations, lead to fire, property damage, or personal injury. This recall is being conducted in cooperation with the U.S. Consumer Product Safety Commission.

In order to ensure that all potentially non-conforming product is captured, all of the affected catalog numbers with the identified date codes listed below will need to be quarantined and returned.

Product	Catalog Number	Affected Date
Circuit Breakers	Q115, Q120, Q130, Q215, Q230, Q250, MP115, MP115U, MP120, MP130, MP215, MP230, MP230U, MP250	0610, 0710
Load Centers	G2020B1100CP, G3030B1100CP, G4040B1200CUSGP, LC4040B1200P, G3040B1200CP, G3040L1200CP, G4040B1200CP, G3030B1150CP, W3040B1200CP, G1624L1125CP, W4040B1200CP	Jun. 23, 2010 – Aug. 25, 2010
Meter Combos	JA2040B1200SP	Jun. 23, 2010 – Aug. 25, 2010

Circuit Breaker



Affected Date Code
0610, 0710

Load Center

Production date code in the metallic box





Meter Combo

Production date code in the metallic box



Load Center and Meter Combo Carton

Production Date code is stamped above/near Master Carton Label

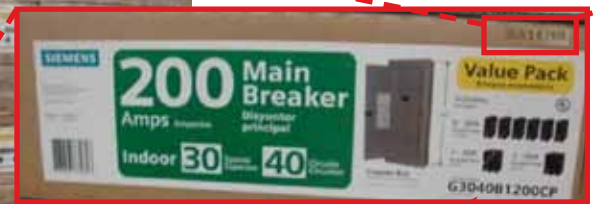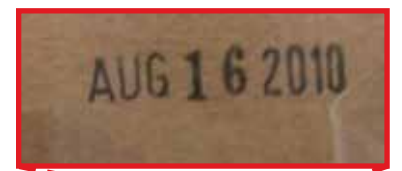

The Catalog No. on the master carton label is G3040B1200CP

Please contact **1-800-756-6996** for questions or to initiate your product replacement process. Please reference Siemens and Murray Circuit Breakers, 15 through 50 Amps, when calling.

For more information and to register for the recall directly, please visit our website: www.usa.siemens.com/pluginrecall